



# PROBLEM SOLVER<sup>®</sup>

## BULLETIN

# Upper Ball Joint Replacement


[www.moogproblemsolver.com](http://www.moogproblemsolver.com)

2005-2007 Cadillac STS,  
2004-2007 SRX

### PROBLEM:

**OE front upper ball joint only available as part of upper control arm/spring mount assembly**

When it is necessary to replace the upper ball joint on these vehicles, the OEM upper ball joint cannot be ordered separately from the dealer. It is only available as part of the complete aluminum control arm/spring mount assembly.

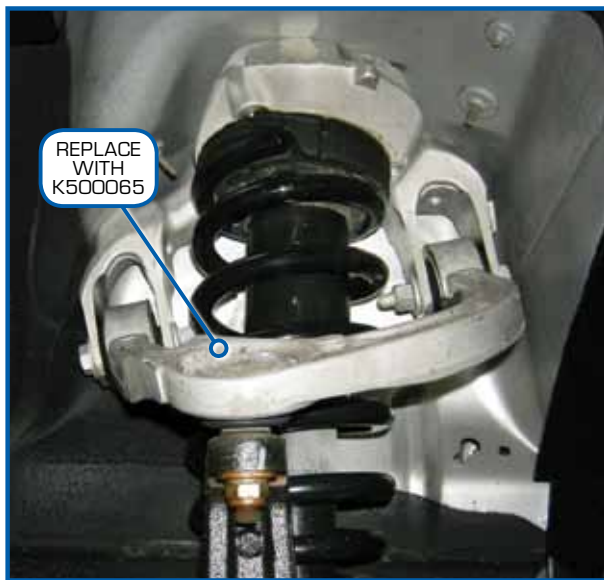

REPLACE WITH K500065


Upper Control Arm/Spring Mount Assembly

Description	Years	Make/Model	Part Number
Upper Ball Joint	2004-2007	Cadillac SRX	K500065
	2005-2007	Cadillac STS	

### SOLUTION:

**MOOG<sup>®</sup> K500065 Upper Ball Joint**

The MOOG K500065 upper ball joint is available as a separate component, so the control arm assembly does not have to be purchased to replace the ball joint. The MOOG premium K500065 resin-plated housing helps prevent galvanic corrosion between the aluminum control arm and ball joint housing. Its problem solving and serviceable design aids in longer life.

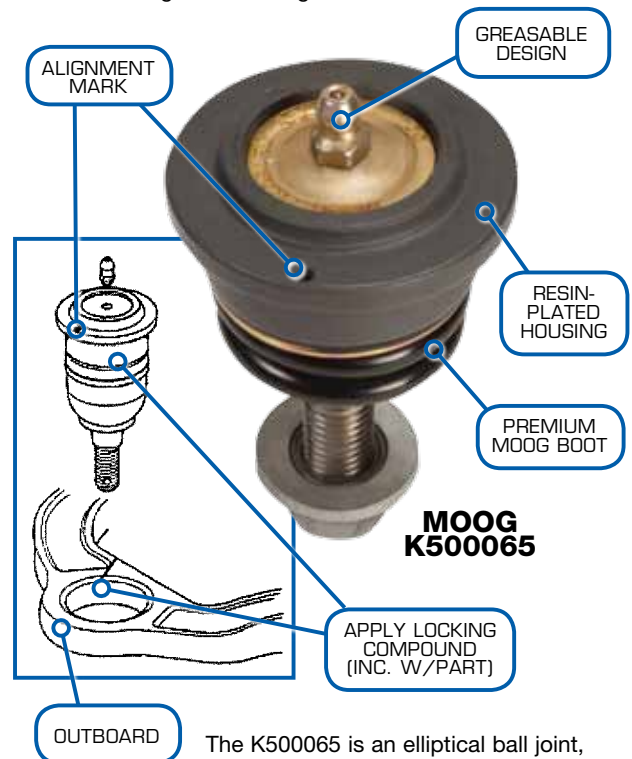

The K500065 is an elliptical ball joint, and requires special orientation when installing. See Problem Solver Bulletin 217028-R. Please be sure to refer to the instruction sheet included with the part



THE PROBLEM SOLVER<sup>®</sup>

