

PROBLEM Solver™ BULLETIN

BULLETIN: 25953

Front Coil Springs Breaking

1998–2000 Ford Contour and Mercury Mystique

PROBLEM:

Front Coil Springs Breaking

- Front coil springs for the Ford Contour and the Mercury Mystique from 1998 to 2000 could potentially fracture due to corrosion and fatigue. Tires can be punctured by coming in contact with a broken spring.




Application	Replacement Part No.
Ford Contour and Mercury Mystique w/automatic and manual transmission and air conditioning. 4 Cyl. 2.0L eng. 1998-2000	80160
Ford Contour and Mercury Mystique w/automatic and manual transmission and air conditioning. 6 Cyl. 2.5L eng. 1998-2000	80162

SOLUTION:

MOOG® Coil Springs 80160 and 80162



- MOOG offers a replacement, constant rate coil spring that is designed to provide more strength and durability.
- Creates lower stress throughout the spring to resist fatigue due to a larger diameter bar and a higher spring rate.
- Incorporates a shorter free height.
- Resists corrosion with an improved, coated material.
- Resists spring clash with a plastic sleeve.
- Tougher spring provides a firmer ride for better handling.

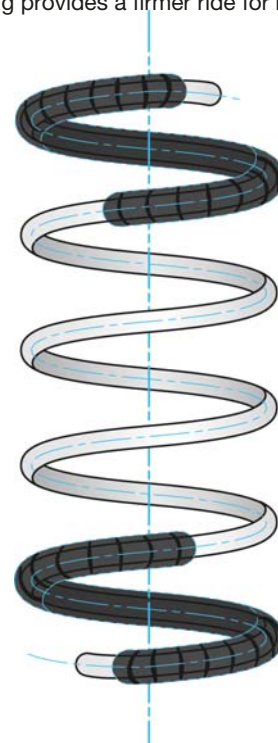

Be Car Care Aware

MOOG
CHASSIS PARTS™

The Problem Solver™

FEDERAL-MOGUL
MOTORPARTS